

M15


OPERATION MANUAL



TABLE OF CONTENTS

OPERATION OVERVIEW AND GENERAL INTRODUCTION	1
INTRODUCTION	2
MANUAL MODE	3
SINGLE MODE	3
PRE-SET PROGRAM (10 SETS).....	4
PROGRAM LOCK AND OPEN(10 SETS)	5
FAST PROGRAM.....	6
FINE ADJUSTMENT	6
LOAD DATUM VALUES.....	7
SELECT COUNTING DIRECTION(+/-)	8
RESOLUTION	9
SENSOR CALIBRATION	10
SET PARAMETER	11
PARAMETER	12
PARAMETER LOCK AND OPEN	13
TROUBLESHOOTING	14
INSTALLATION GUIDE	16
POWER SUPPLY & HARDWARE	18
EXTERNAL DIMENSION	19

Operation Panel

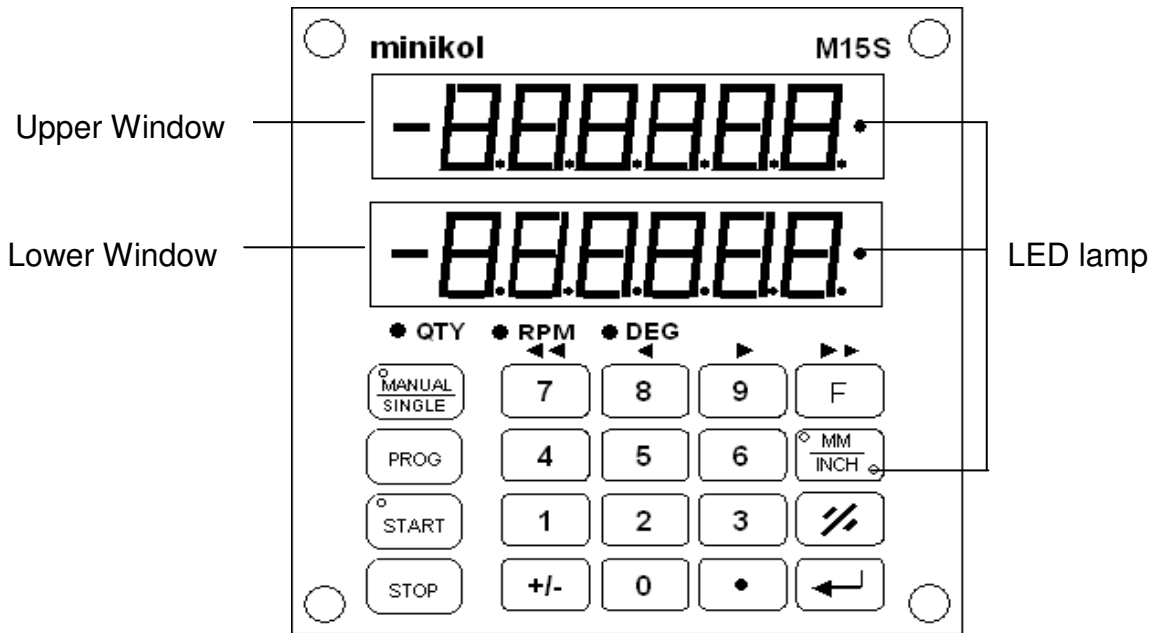

LED / KEY	Description	KEY	Description	KEY	Description
Upper Window	Target value		Manual / Single mode		Parameter
Upper LED	Target value LED		Program		mm / inch
Lower Window	Current value		Active		Clear / Return
Lower LED	Current value LED		Stop / Cancel		Confirm / Enter
0 ~ 9	Number keys		+ / -		Decimal

Note: Display : LED on / blinks

Introduction

Function:


- | | |
|------------------------------------|---------------------------------------|
| 1. One or two speed positioning | 7. Resolution: 0.1mm/ 0.05mm/ 0.01mm |
| 2. Manual / Single mode | 8. Correct zero point |
| 3. 10 sets single program | 9. Display: RPM speed |
| 4. 10 sets tool offsets | 10. Protection for tool / motor fault |
| 5. Quick program / Fine Adjustment | 11. Battery life 2.5 year |
| 6. Inch / mm conversion | 12. Self-diagnose |

Specification:

1	Housing:	115w × 115h × 80d (mm)
2	Panel cut out:	93w × 67h (mm)
3	Mounting screws:	M3 × 4 104 × 104 (mm)
4	Supply voltage:	24VDC/50mA/, C type battery (1.5V) × 1
5	Battery voltage control:	Low battery alarm
6	Sensor cable length:	3m
7	Thermal expansion:	$\alpha = 16 \times 10^{-6} \times 1/K$
8	Gap sensor/strip:	max. 2.5mm
9	Display:	15mm LED × 6 digits × 2 line
10	Output:	4 digital output (AC250V / 7A;DC24V/10A)
11	Input:	4 digital input (24VDC)
12	Operating elements:	20 button keyboard
13	Test mark/ interfere Protection class:	3 accord. to IEC 801
14	Travel Speed:	1.5m/s
15	System accuracy:	$\pm (0.025+0.02L)mm, L: Meter$
16	Repeatability:	0.01mm
17	Temperature:	Operating temperature 0 + 50, Storage temperature -20 +70°C
18	Humidity:	max. 95% rF(Condensation not permitted)

Manual Mode

Description: To move the machine table by pressing M15 keyboard.

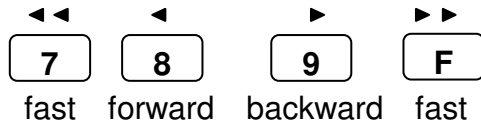

Example: M15 displays 100.00mm, to move the machine table:

※Note: Be sure in “**manual**” mode. (LED lamp of “manual / Single” key is blinking) The upper window shows “HAnd” mode.

= H A n d

106.80

Press MANUAL
SINGLE to move machine table 7 forward (fast).

H A n d =

96.80

Press F to move machine table backward (fast).

Note: Press 8 or 9 for forward/ backward/ lower speed (depends on machine and wiring).

Single Mode

Description: M15 can execute auto positioning.

Example: M15 current value is 100.00mm, to reach 200mm (setting target value).

100.00

100.00

200.00

100.00

Step1. Select single mode MANUAL
SINGLE LED lamp is off.

Step2. Press PROG, blinking, enter new target value 2 0 0 ←


LED lamp is off, complete.

※Note: During positioning, press STOP to stop; to re-start, press PROG and ←

Pre-Set Program (10 sets)

Description: Pre-set program 10 sets, enter program # 0~9 to execute.


Example: Program 1=10mm, Program 2=20.00mm.

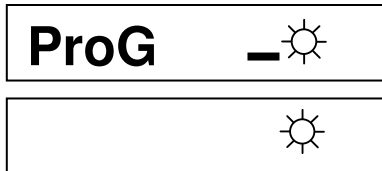

Step1. Press **F** **5** **5**


select enter a key (0-9, total of 10sets).

※Note: Be sure in manual mode.

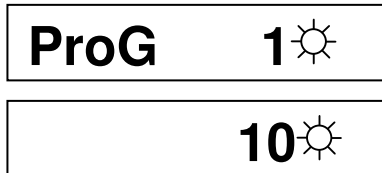

Step2. (Enter program 1=10mm), press **1**

more press **1** **0** .

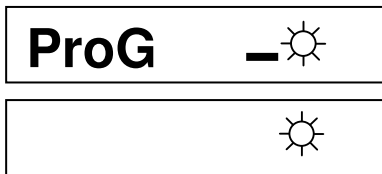

Step3. Target value display: ProG_☀ at present,


enter program 2=20.00mm, press to

exit.

Program Open and Lock (10 sets)

Description: Don't needs pre-set program, to start or close.


Example: Program 1=10.00mm for , program 2= 20.00mm for ,
 ~ other a key, don't setting pre-set program, to stop follow
 steps as below:

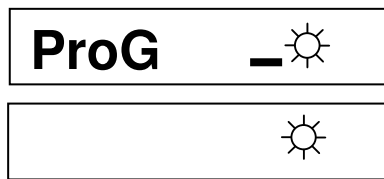

Step1. Press


target value display: ProG_☀.

※Note: Be sure in single mode.

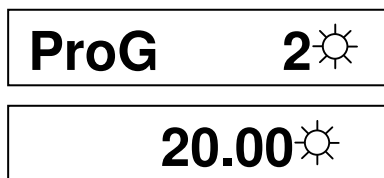

Step2. Press

current value display: _ _ _ _ _ , closed,
 frame display, started.

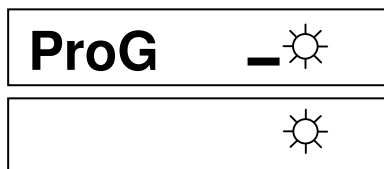

Step3. Press to close

※Note: To close other keys, follow the step 2, 3.

Fast Program

Description: To facilitate frequently used positions, the keys 0 to 9 have associated preset target values. And the positioning can be started immediately.


Example: Program 1=10.00mm, program 2=20.00mm. Execute program 2 as below:



100.00

100.00

20.00

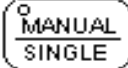100.00

Step1. Select single mode  LED lamp off.

Step2. Press  target value display: 20.00mm
 LED blinking, to waiting start.

※Note: Execute program1 press#1.



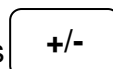

Fine Adjustment


Description: Increase and decrease to reach fine adjustment.


Example: M15 target value display100.78mm, increase/ decrease target value0.25mm, setting steps as below:






0.00 

100.00

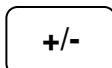Step1. Increase target value: press 
display 0.00  LED blinking,
decrease: press  twice,
display-0.00  LED blinking.

0.25 

100.00 

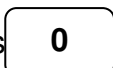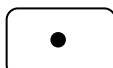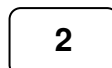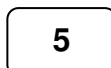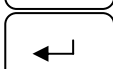Step2. Press    
press  to completed.

※Note: Target value display: 101.03mm, current value display:100.78mm for target value increase 0.25mm.

Load datum values


A. Description: To load current value according to working piece.

Example: M15 current value display 100.00mm, actual size: 100.50mm, follow the steps as below:










100.00

100.00


OriGin 

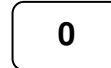100.00 


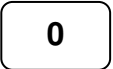
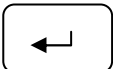
Step1. Select single mode  LED lamp off.

Step 2. Press    , enter new value, press      press  , to exit.

B. How to show the new set value:

F 0 

100.00

Step1. Press   , press  twice, display new value.


Select Counting Direction(+/-)

Description : To select the counting direction.

Example : M-15 current value display: 100.00mm, sensor forward for decrease value 99.68mm, but hope value become big, value increase follow the steps as below:

100.00

99.68


F 1 




99.68



-dir

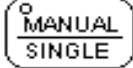100.00

99.68

Step1. Press  back single mode, LED lamp off.

Step 2. Press   
target value display origin parameter value “-dir”
(select counting direction parameter).

Step 3. Press  to select the direction, -dir / dir 
(or“-dir” for left or “dir- ” for right.)


Step 4. Press  to complete, and exit.

Resolution

Description: Select resolution: 0.1mm/0.01mm/0.05mm.


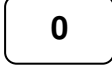

Example: M15 current value display 100.0mm, to select display: 100.00mm follow the steps as below:


100.0

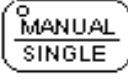Step 1. Select single mode  LED lamp off.

100.0

 
F 90 


Step 2. Press     to select resolution.


100.0 


rES 

Step 3. Press  /  (0.1 / 0.01 / 0.05)

0.01 


100.00 

 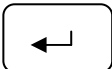Step 4. Press  to complete and exit.

100.00 


Sensor Calibration

A. **Description:** For better accuracy, please execute calibration immediately after installed sensor each time.

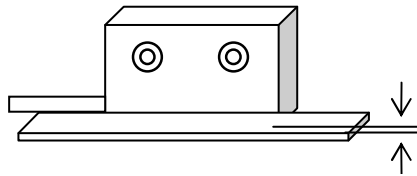


Gap sensor-tape

Step 1. Fix sensor, keep 1mm gap from tape
(RECOMMENDED).

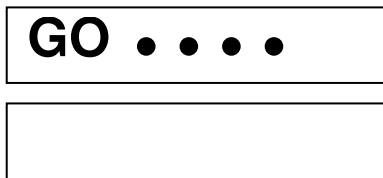


Step 2. Press **F** **9** **9** **↵**
Target value display GO●●●● (Enter parameter)

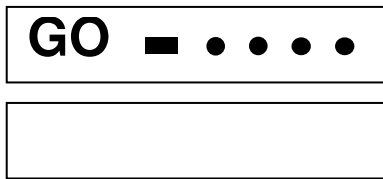

Step 3 · Press and hold **8** or **9** to start.


※Note : Moving the slider at low speed, Required distance around 120mm (Moving GO●●●●)
Display: **GO ■●■●●●** (Detecting)
Display: **GO ■●■●■●●●** (Almost complete)

When completed calibration, LED display will flash and show.

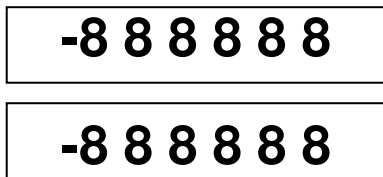


※Note: Please reload origin datum values refer to page8.


B. Troubleshooting of calibration:

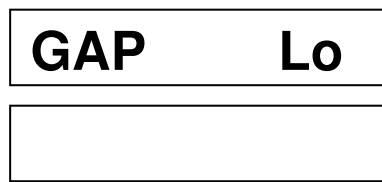

a. Display: GAP LO


Possible cause: The gap is too narrow.


Excluding: Please enlarge the gap. Press  and follow step 2 again.

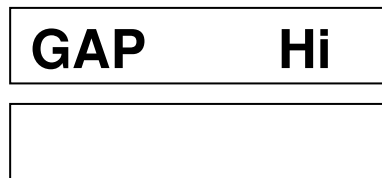

b. Display: GAP Hi

Possible cause: The gap is too big.

Excluding: Please narrows the gap and press  calibration again.

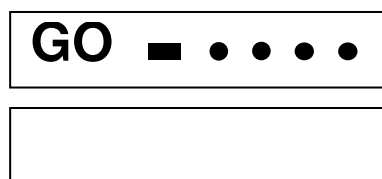



c. Display: GO●●●● or GO■●●●● or


GO■●■●●●

Possible cause: The gap too big or machine surface is not flat/smooth.

 
Excluding: Adjust gap or improve the machine surface.



   
d. During calibration press  to exit.


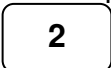



Set Parameter





Step 1. Select single mode  LED lamp off.



 Step 2. Press  select enter parameter #, example parameter 2, press 



 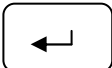Step 3. Press  target value display OriGin(Lond parameter)




※Note: Refer to set parameter or page12.



※Note: Press  to exit.

Parameter

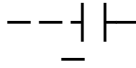Parameter	Display	Description	Default	Remarks
0	CHAnGE	Load datum value	0	
1	dir	Select counting direction (+ / -)	-dir	
2	OriGin	Load origin	0.00mm	
3	OffS-	Set tool diameter	0.00mm	
4	POSdir	Positioning mode		
5	SPEEd	One or two speed positioning	1sp	
9	LoAd 0	Load tool diameter	0.00	
10	Lo-End	- Software limit	-50.00mm	
11	Hi-End	+ Software limit	1000.00m m	
15	InPOS	Positioning output time	0.15ms	
17	toLL	Tolerance	0.30mm	
19	FAuLt	Low speed limit	55	
20	LinCOr	Linear correction	1.00000	
30	PASS	Parameter lock	----	
33	SOurCE	Software version		
55	PrOG-	Fast program		
90	rES	Resolution	0.01mm	
99	GO....	Sensor calibration		

Parameter Lock And Open

Description: Needless function can open or close, to prevent client operation unsuitable to cause the fault.

100.00

100.00

PASS ☀

☀

dir ☀

on ☀

dir ☀

on ☀

Step 1. Select single mode  LED lamp off

Step 2. Press    

target value display "PASS" ☀ blinking,

current value display: _ _ _ _ ☀ blinking

Step 3. Press    

into the on/off set parameter.

※Note: Press   or  

(dir/ OriGin/ FAULT/ inPos)


Step 4. Press  setting on/off

Example: Frame display "dir off" indicate ±direction

parameter open.

Frame display: "dir on" indicate ±direction

Parameter close.

Press  to setting and exit.

Troubleshooting

SEnSor

Error

1. Possible Cause: No sensor

Excluding: a. Power off

b. 9 Pin connector is loosen or wire broken

c. The gap is too big between sensor and tape.

CHAnGE

rst

2. Possible Cause: A motion in the wrong direction.

Excluding: a. Power off b. Change R. S. T.

EnGinE

FAuLt

3. Possible Cause: a. Motor fault or overload.

b. Motor fault investigate setting wrong (F19)

c. External limit action

Excluding: a. Press



b. Check parameter F19

c. Power off

d. Check external limit

e. Check motor and control line

100.00☀

100.00

4. Possible Cause: a. Over soft limit

b. Target value setting wrong

c. Parameter value setting wrong

Excluding: Press


 
 


Lo Err

5. Possible Cause: Current value over soft low and high
(F10 · F11)

※Note: Frame show Lo/Hi

Excluding: a. Check machine table whether over the
travel.

b. Press  LED blinking
press  or  to exit.

c. Please reload origin datum values refer
to page8.

CHAnGE

bAtt

6. Possible Cause: Indicates battery discharged

Excluding: a. Power off

b. Change the battery(1.5V * 1 tape)

c. Turn the power on again

d. Please reload origin datum values refer
to page8.(If current value lose)

100.00 

100.00

7. Possible Cause: Waiting for enter target value

Excluding: a. Enter new target value

b. Press  to exit

F 

100.00


8. Possible Cause: In the parameter setting value

※Note: Frame show F/origin

Excluding: Press 

Installation Guide

* The magnetic tape consists of three components:

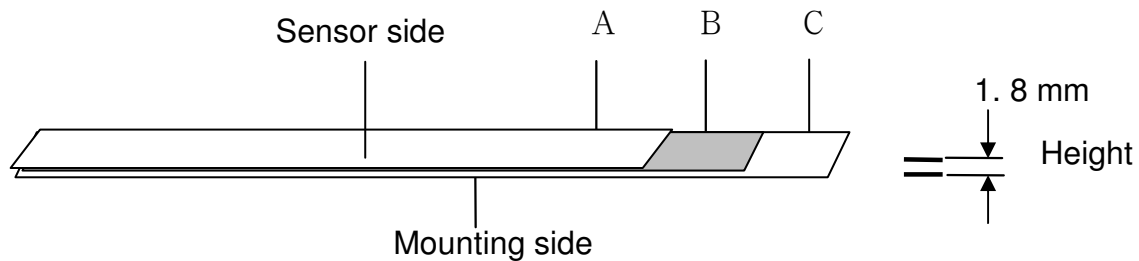

L

A. A magnetized, highly flexible synthetic tape.

B. Flexible steel tape. A and B are already factory-bonded.

C. To keep the flexibility for transport and installation, the third part, also a steel tape is delivered separately. It serves for mechanical protection of the synthetic tape and must be stuck on the magnetic synthetic tape after installation.

Installation:


- There components of tape: depth:1.8mm, width:10mm.
- Ensure to apply tape on clean, dry and plain surface.
- Be sure the tape adhesion on surface.
- Please apply the tape with ambient temperature: 21~38°C
- We recommend to make a chamfer on the machine to install the tape.
- If cut a edge can stable the tape.

Cable:

- Distance more than diameter 50mm.
- Must be away from inductive and capacitive interference source as conductor, relays, motors, switch power pack clocked controllers, etc
- Must be kept a distance to interference sources.




Sensor:

- Allow some fault when install the sensor.
- Attend the position when install the sensor.

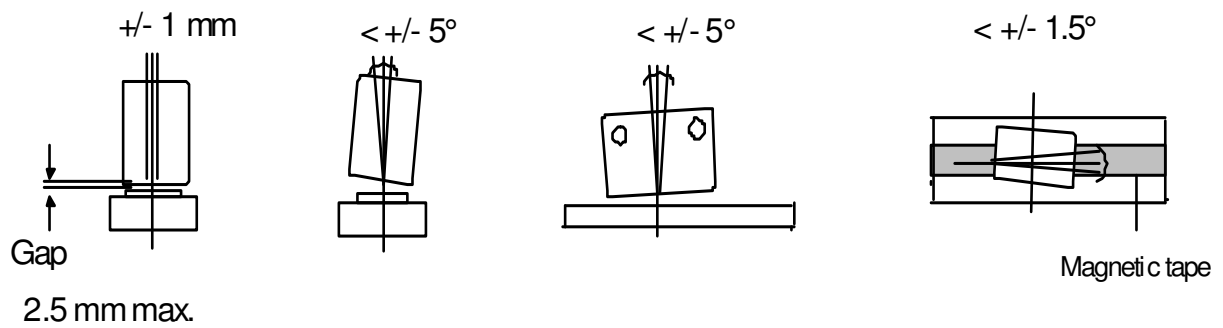

Recommend Gap between tape and sensor: 1mm

Unit: mm

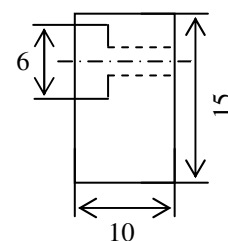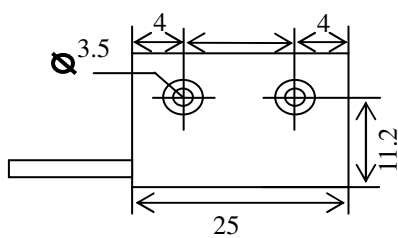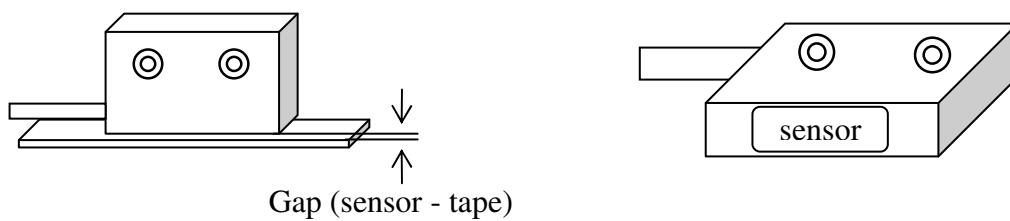

Power Supply & Hardware

Power supply: a. 2 PIN connector
 b. DC 18 ~ 30V 50mA

Battery: C type battery×1, the battery life: 2.5 year(24hr)

Output: a. 8 pin connector

b. Relay × 4: Forward Reverse Low speed Positioning.

Note: Positioning only works inside the tolerance and on position mode.

Manual mode: Do not work.

c. NO

d. AC240V/ 5A AC120V/ 10A DC24V/ 10A

Input: a. 5 Pin connector

b. DC 24V


c. NPN or PNP

d. 10mA


- COM
- Start
- Stop
- Repeat
- No use

Sensor : 9 pin connector


Back panel(face squarely)

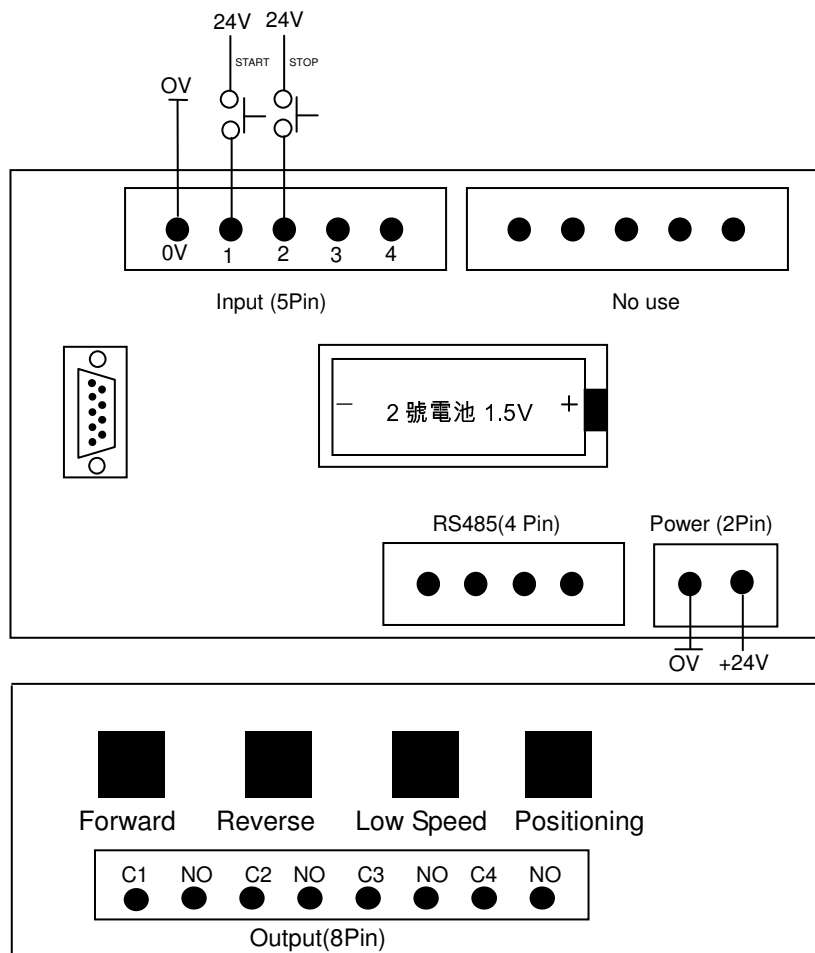

External Dimension

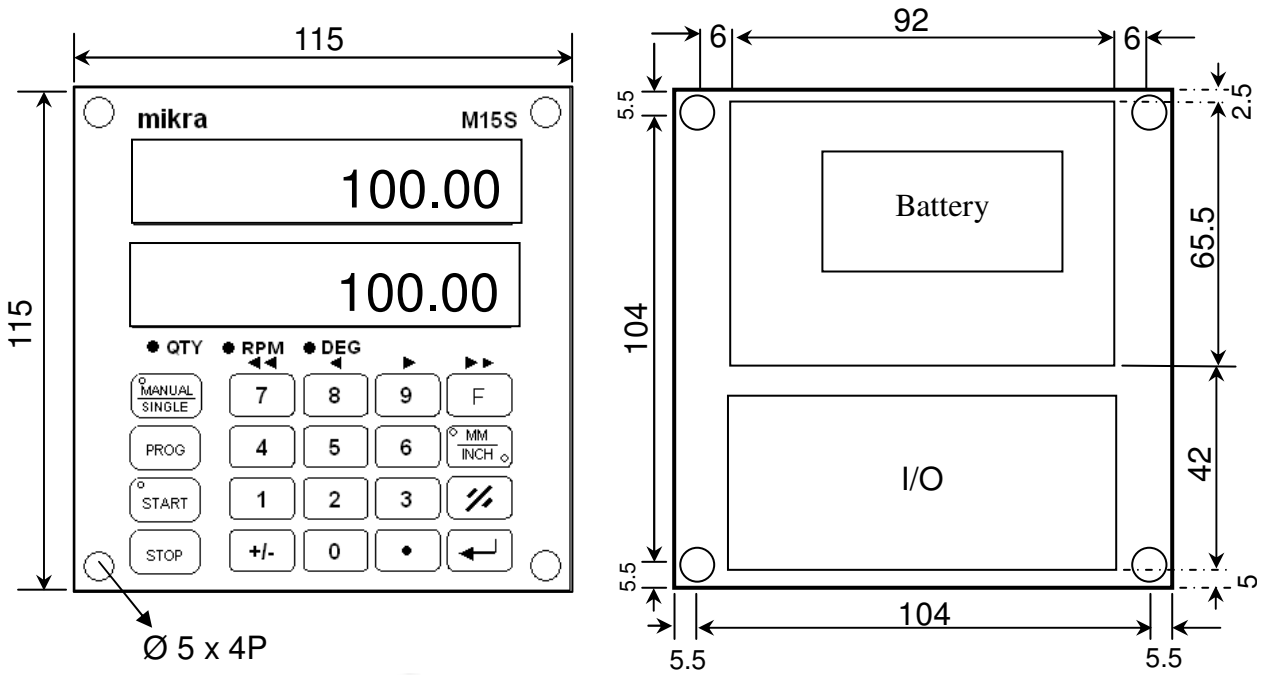

Ø 5 x 4P

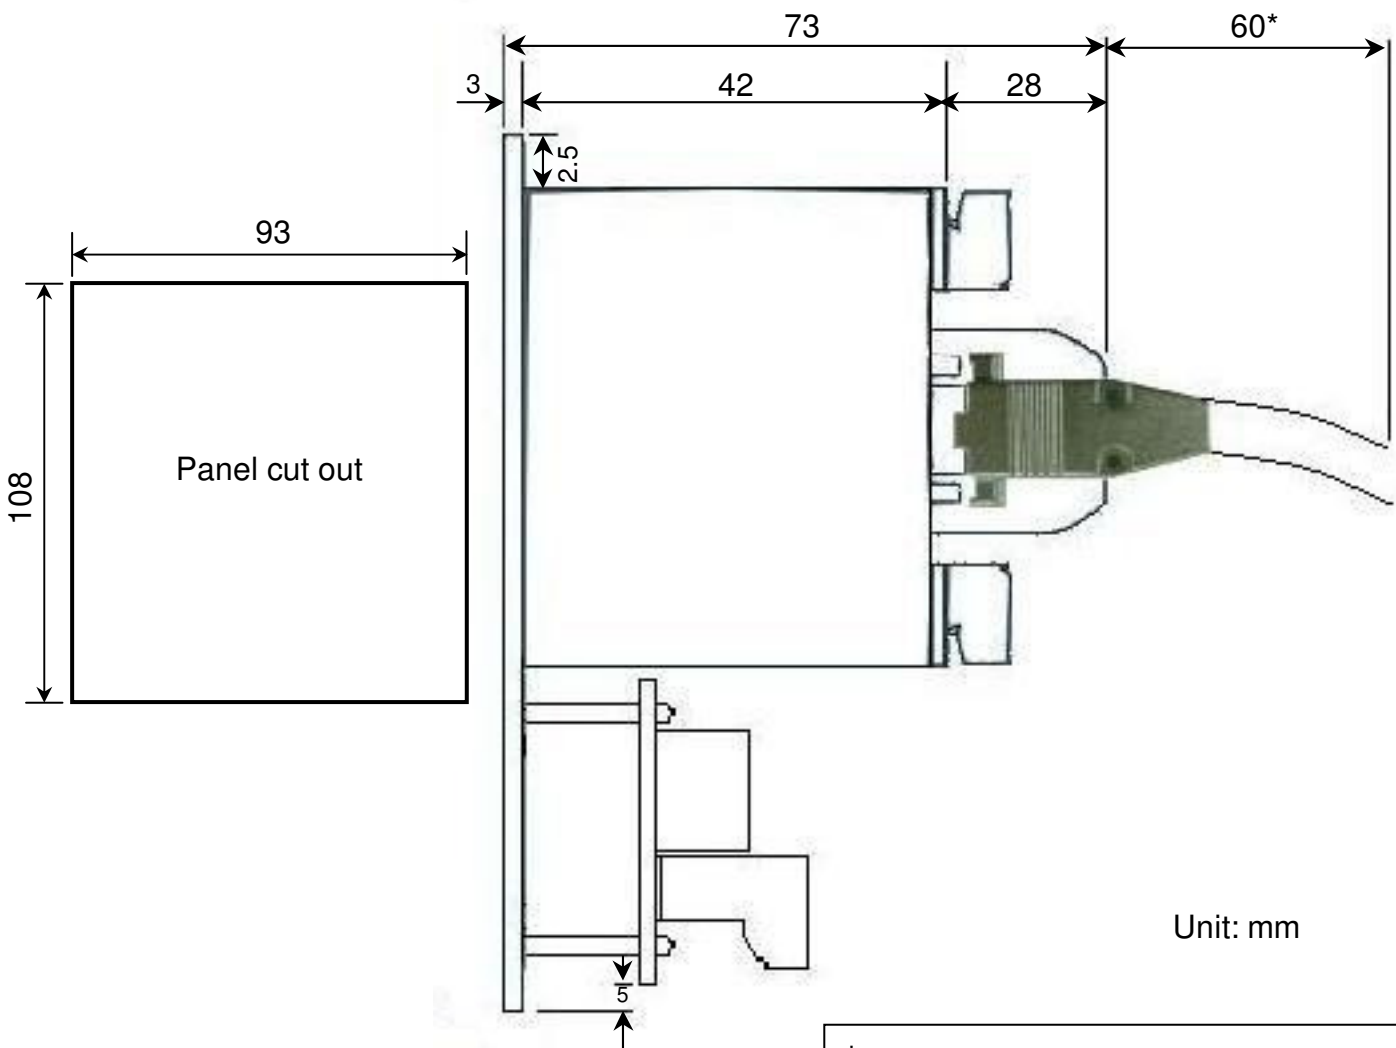

Unit: mm

*: Required extra space for installation: 60mm